

## Hybrid Racing Heavy-Duty Transmission Detent Springs (K-Series)

Use this information as a general reference guide to installing the Hybrid Racing Transmission Detent Springs into the Honda K-Series transmission.

Written By: David Cordell



## **Step 1 — Locate Detent Springs**







- Use these steps as a GENERAL guide to locate and install the K-Series Detent springs.
- The transmission pictured is a K20A2 trans case. The detent spring locations will be the same for the K20A/A2/A3 & Z1 case. The K24 & K20Z3 transmission cases are slightly different, but all are in a similar spot.
- ② You may need to remove the engine mount if you are doing this install while the transmission is still in the car. Some installs, like the Acura TSX CL7/CL9 can be accomplished without removing the mount.

## Step 2 — Detent Spring Removal



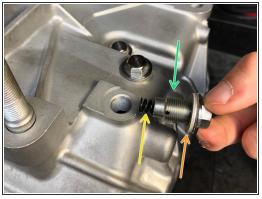


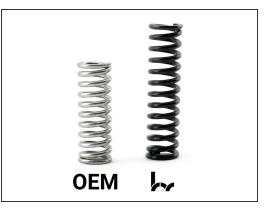

- Remove each of the three gear selector detent springs. On the K-Series transmission, they are located on the top of the trans case.
- Once you remove the detent spring housing, remove it slowly making sure no dirt or debris fall into the case.
- If your transmission has washers be sure to keep the washer in place and do not lose it. If you fail
  to reinstall the washer you run the risk of damaging the bolt and not being able to get the
  transmission into gear.
- Swap the stock, silver spring for the longer black HR detent spring. The ball detent should remain inside of the transmission case.
- Notice the Black Zinc Chromate plated HR springs are taller. You will remove the silver springs and install the taller ones.

## Step 3 — Spring Installation



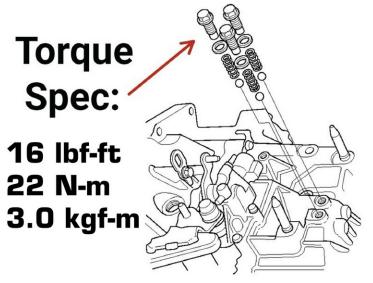

- Once you have changed all three springs, thread the bolts back in by hand.
- ⚠ Be VERY CAREFUL, these are thin-walled bolts that can strip very easily.
- ① Use a torque wrench and tighten to 16 lbf-ft (22 N-m / 3.0 kgf-m). Do NOT over-tighten as the bolts will break.
- Once all bolts have been torqued to spec, row through all gears and confirm everything feels right. The forward and back motions (1st to 2nd, 2nd to 3rd, etc) will be noticeably stiffer and direct. This is normal, the springs will require more force to move due to the increased length.
- Check for leaks after driving, if all is good, enjoy!

K20Z3 requires removing the intake and motor mount; took an hour and a half with nothing seizing and everything coming out smoothly.